

## Installation notes: Hotfix2 for MOVI-C® CONTROLLER UHX25A (System package 10 B7.3)

Hotfix2 for the MOVI-C® CONTROLLER standard (UHX25A) (system package 10 B7.3) fixes the following problem:

The engineering connections regarding the Visu connection, the programming system and the applicative socket communication can be disturbed (limited robustness). Affected are the engineering port X80 of the UHX25A; Not affected by this are the communication links to SBus plus / EtherCat.

Hotfix2 increases the robustness of the (described) socket communication significantly.

[Hotfix2 für MOVISUITE](#) is included in the Hotfix2 for MOVI-C® CONTROLLER.

### Installation guide


Follow these steps to install the Hotfix2 on your MOVI-C® CONTROLLER:

#### Download the firmware image:



- Klick the button [Download].
- Open and extract the entire ZIP folder „SEW\_Hotfix2\_UHX25A\_SP10-B7.3\_V3.02.zip“

#### Copy the firmware image to the memory card:

1. Turn off the MOVI-C® CONTROLLER.
2. Remove the memory card from the MOVI-C® CONTROLLER.
3. Insert the memory card into a memory card reader.
4. Copy the downloaded firmware image by copying the entire folder contents of the „FS“ folder.

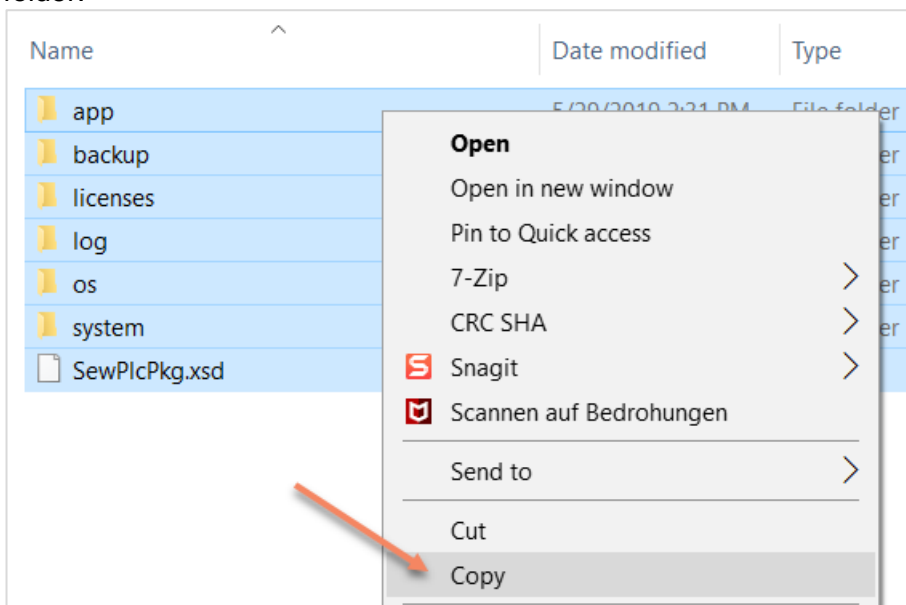


5. Insert the copied firmware image on the memory card.  
**Note:** Leave all existing files and folders on the memory card and copy the firmware image over it.

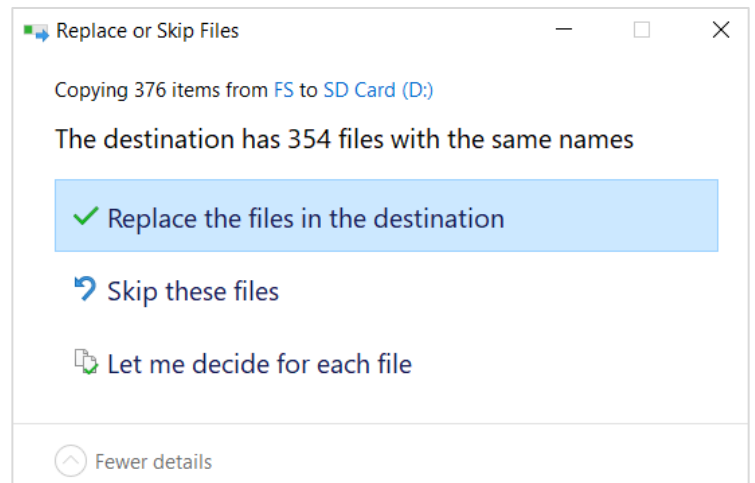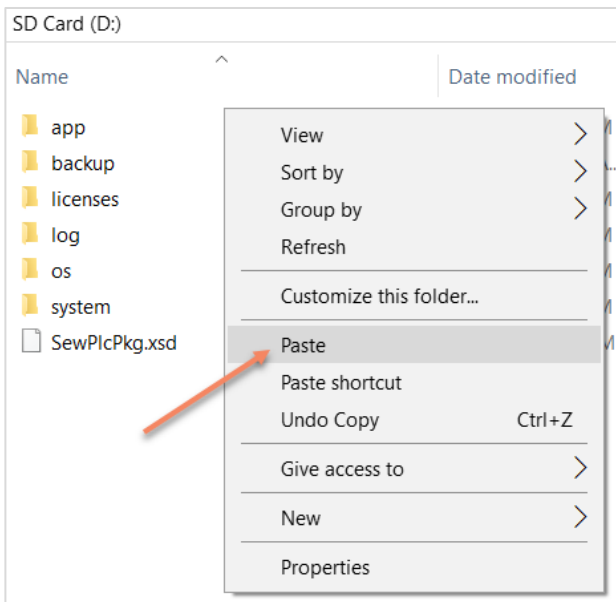

Here you have to replace certain files in the destination.

6. Insert the memory card in the MOVI-C® CONTROLLER.
7. Turn on the MOVI-C® CONTROLLER.  
→ The project now shows on the controller node that the version has changed.
8. Click the button [device→ PC].

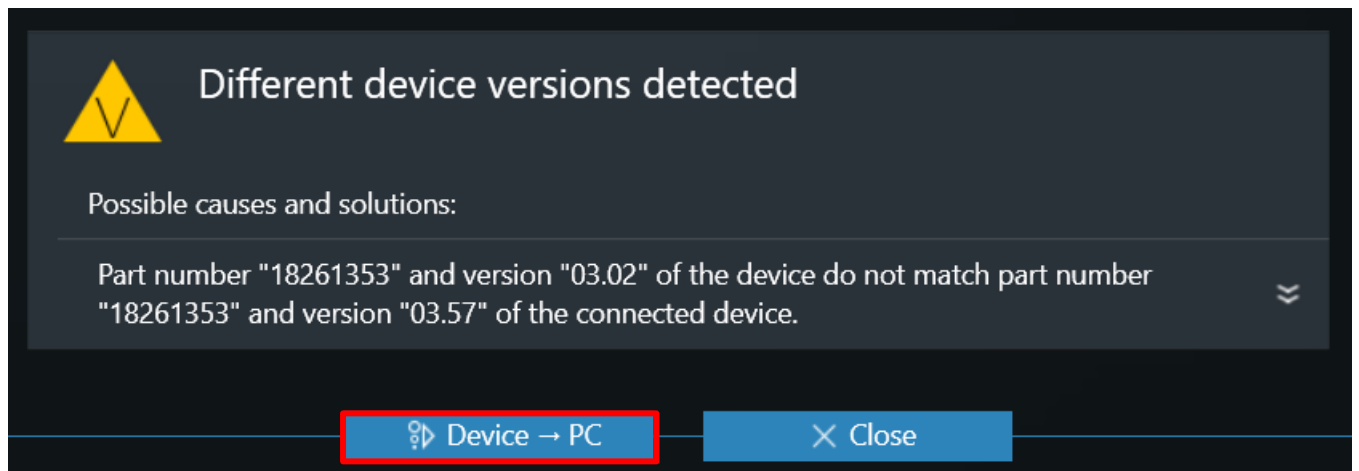

- The firmware update is completed.